



## **Machine Screw Nuts**

Small Pattern

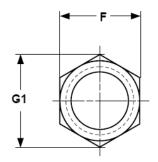



SMALL PATTERN HEX MACHINE SCREW NUTS									
Nominal Size or Basic Thread Diameter		F Width Across Flats			G1 Width Across Corners		H		
									Basic
		4	0.1120	3/16	0.188	0.180	0.217	0.205	0.066
5	0.1250	1/4	0.250	0.241	0.289	0.275	0.098	0.087	
6	0.1380	1/4	0.250	0.241	0.289	0.275	0.098	0.087	
8	0.1640	1/4	0.250	0.241	0.289	0.275	0.098	0.087	
8	0.1640	5/16	0.312	0.302	0.361	0.344	0.114	0.102	
10	0.1900	1/4	0.250	0.241	0.289	0.275	0.098	0.087	
10	0.1900	5/16	0.312	0.302	0.361	0.344	0.114	0.102	

Description	Similar in design to standard hex machine screw nuts but with smaller widths across the flats and across the corners.				
Applications/ Advantages	Designed to be used with machine screws in areas where there is limited space for wrenching. Stainless nuts are used with stainless machine screws where parts are subject to corrosive conditions.				
Material	Steel: Any low carbon steel Stainless: 18-8 stainless steel				
Plating	See Appendix-A for information about the plating of steel machine screw nuts				